

TEST REPORT

### Report No. : PN:TR:1354009141

DATE: 05/08/2022

CARZSPA AUTOFRESH PRIVATE LIMITED 204, SIDDHI VINAYAK PLATINUM, OPP D.MART ON VIP ROAD, NEAR KAILASHNAGAR SURAT-394220 IN

**CONTACT PERSON** : ANCKUR SAMA

# THE FOLLOWING SAMPLE(S) WAS/WERE SUBMITTED AND IDENTIFIED BY/ON BEHALF OF THE CUSTOMER AS :SAMPLE DESCRIPTIONCRYSTALSHIELD PENTAGON 10 HOEMOTHERCOUNTRY OF ORIGININDIASAMPLE RECD ON21/07/2022TEST(S) REQUESTEDALKALI RESISTANCE TEST

#### ALKALI RESISTANCE TEST: ISO 2812-1:2017, Clause no. 9.3.1 (Method A)

2

#### Test condition

The test panels conditioned for 16 hrs. under standard conditions at  $(23 \pm 2)$  °C and  $(50 \pm 5)$  % relative humidity.

- The test conducted at (23 ± 2) °C and (50 ± 5) % relative humidity.
- Poured a sufficient quantity of test liquid into a suitable vessel to immerse the test panel to the required depth.
- Stand or hang the test piece in an approximately vertical position in the vessel, so that it is half-immersed in the test liquid.
- Immersed the sample for 24 hours at room temperature.
- After the test period has expired, wipe the test piece with a cloth. Clean off any dried residue of aqueous test liquids under running water and clean off the dried residue of any other test liquids with a solvent that does not attack the coating.
- Evaluated only the area which has been in direct contact with the test liquid.
- Immediately assess the test piece for blistering as specified in ISO 4628-2. Rate any visible alterations as specified in ISO 4628-1.
- The test piece allowed to equilibrate in a dry condition for 24 h & reassess the exposed area.

Test liquid : Sodium hydroxide solution, with a mass fraction of 5 % sodium hydroxide.

#### Rating scale

As per ISO 4628-1;

Rating	Intensity of change		
0	Unchanged, i.e., no perceptible change.		
1	Very slight, i.e., just perceptible change.		
2	Slight, i.e., clearly perceptible change.		
3	Moderate, i.e., very clearly perceptible change.		
4	Considerable, i.e., pronounced change.		
5	Very marked change.		

#### JOE No. : 2254802136

Page -1 of 3

Control No.:1354507559

This document is issued by the Company under its General Conditions of Service printed overleaf or available on request and accessible at http://www.sgs.com/terms\_and\_conditions.htm and Terms and Conditions for electronic documents www.sgs.com/terms\_e-document.htm. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only. This document cannot be reproduced except in full, without prior approval of the Company.

 SGS India Private Ltd
 Transportation Laboratory, Gat No. : 624/2, Kuruli, Chakan, Taluka – Khed, Pune-410501, Maharashtra, India,

 Phone: +91 2135 615300, Fax: +91 2135 615333 www.sgs.com



**TEST REPORT** 

DATE: 05/08/2022

#### Report No. : PN:TR:1354009141

2


No. of Sample 01 :

**Observation** 

Observation as per ISO 4628-1						
Sample no.		Characteristic value	Intensity of change			
1 .	Immediately after the test	1	Very slight, i.e., just perceptible change.			
	After 24 hours	1	Very slight, i.e., just perceptible change.			

Blister rating as per ISO 4628-2							
Sample no.		Blister density	Blister size				
1	Immediately after the test	0	0				
	After 24 hours	0	0				

#### Test photographs :

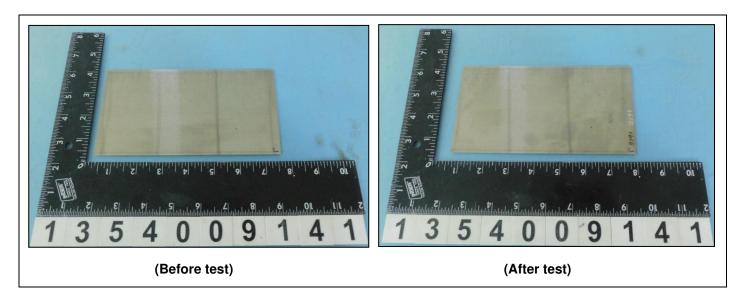

#### JOE No. : 2254802136

Page -2 of 3

Control No.:1354507559

This document is issued by the Company under its General Conditions of Service printed overleaf or available on request and accessible at http://www.sgs.com/terms\_e-document.htm. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only. This document cannot be reproduced except in full, without prior approval of the Company.

Transportation Laboratory, Gat No.: 624/2, Kuruli, Chakan, Taluka - Khed, Pune-410501, Maharashtra, India, SGS India Private Ltd Phone: +91 2135 615300, Fax: +91 2135 615333 www.sgs.com



**TEST REPORT** 

## Report No. : PN:TR:1354009141

Test performed as per the conditions given by the client. Note

Per pro SGS India Private Ltd.

\*\*\*\*\* End of Report\*\*\*\*\*

ambe

Bhushan Tambe Executive

Email your Test Report Related Enquiries at Feedback.trp@sgs.com

JOE No. : 2254802136

Page -3 of 3

Control No.:1354507559

This document is issued by the Company under its General Conditions of Service printed overleaf or available on request and accessible at http://www.sgs.com/terms\_and\_conditions.htm and Terms and Conditions for electronic documents www.sgs.com/terms\_e-document.htm. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only. This document cannot be reproduced except in full, without prior approval of the Company.

Transportation Laboratory, Gat No.: 624/2, Kuruli, Chakan, Taluka - Khed, Pune-410501, Maharashtra, India, SGS India Private Ltd Phone: +91 2135 615300, Fax: +91 2135 615333 www.sgs.com